



# EFM32 Pearl Gecko Family

## EFM32PG1 Errata

---



This document contains information on the errata of revision C of EFM32PG1. A future Gecko product is currently planned for 2017.

For errata on older revisions, please refer to the errata history for the device. The device data sheet explains how to identify chip or module revision, either from package marking or electronically.

Errata effective date: November 11th, 2016.

## 1. Errata Summary

**Table 1.1. Errata Status Summary**

Errata #	Designator	Title/Problem	Workaround	Affected	Resolution
			Exists	Revision	
1	ADC_E202	Wait After POR or EM4S Wakeup	Yes	C	Future Gecko product
2	ADC_E206	PROGERRIF (Program Error Interrupt Flag) Will Not Clear	Yes	C	Future Gecko product
3	ADC_E207	ADC Scan Repeat Mode with APORT	No	C	Future Gecko product
4	ADC_E208	ADC Interrupt Flags	Yes	C	Future Gecko product
5	ADC_E209	ADC and PRS Triggers	Yes	C	Future Gecko product
6	ADC_E210	ADC with PRS and Software Triggers	Yes	C	Future Gecko product
7	ADC_E211	ADC Single Repeat Mode and Tailgating	No	C	Future Gecko product
8	ADC_E212	ADC with PRS in ASYNC Mode	Yes	C	Future Gecko product
9	ADC_E213	ADC KEEPINSLOWACC Mode	No	C	—
10	ADC_E214	Using ADC CHCONMODE with PRS	Yes	C	Future Gecko product
11	ADC_E215	ADC CHCONMODE Set to MAXRESP Causes Extra Latency	Yes	C	Future Gecko product
12	ADC_E216	ADC Conversion Start Delay	Yes	C	Future Gecko product
13	ADC_E217	Multiple CLK Mode Switches	Yes	C	Future Gecko product
14	ADC_E218	SINGLEACT and SCANACT Status Flags Delayed	Yes	C	Future Gecko product
15	ADC_E219	STOP Command Causing FIFO Corruption	Yes	C	Future Gecko product
16	ADC_E220	AUXHFRCO in ASYNC mode with ASYNC CLK in ASNEEDED mode	Yes	C	Future Gecko product
17	ADC_E221	ADC Temperature Sensor Must be Used in LOWACC Mode	Yes	C	Future Gecko product
18	ADC_E222	ADC EM2 Wakeup on a Comparator Match Disables EM2 Entry	Yes	C	—
19	ADC_E223	Delayed ADC Conversion or Warmup Start	Yes	C	Future Gecko product
20	CORE_E201	SYSTICK and an External Clock	Yes	C	Future Gecko product
21	DBG_E201	AUXHFRCO Debug Limitations	Yes	C	Future Gecko product

Errata #	Designator	Title/Problem	Workaround	Affected	Resolution
			Exists	Revision	
22	DBG_E202	<a href="#">Debug Access to ADC and LEUART not Functioning as Intended</a>	No	C	Future Gecko product
23	DCDC_E202	<a href="#">Regulated DCDC Output Can Dip on EM2 Entry</a>	No	C	Future Gecko product
24	DCDC_E203	<a href="#">Regulated DCDC Output Can Dip on EM2 Entry if not in LN Mode</a>	Yes	C	Future Gecko product
25	EFR_E201	<a href="#">Bit Access Not Supported for Low Energy Peripherals</a>	Yes	C	Future Gecko product
26	EFR_E202	<a href="#">Read-Clear Access for LETIMER0 and RTCC Interrupts</a>	Yes	C	Future Gecko product
27	EMU_E201	<a href="#">High Temperature Operation</a>	Yes	C	Future Gecko product
28	EMU_E204	<a href="#">Restrictions Writing TEMPHIGH and TEMPLOW</a>	Yes	C	Future Gecko product
29	EMU_E205	<a href="#">Restrictions Reading TEMP</a>	Yes	C	Future Gecko product
30	EMU_E207	<a href="#">GPIO State can be Lost During EM4 Recovery</a>	Yes	C	Future Gecko product
31	EMU_E208	<a href="#">Occasional Full Reset After Exiting EM4H</a>	Yes	C	Future Gecko product
32	EMU_E209	<a href="#">Potential EM2 Lock-up when using IDAC or the Debugger with the LDMA</a>	Yes	C	Future Gecko product
33	EMU_E210	<a href="#">Potential Power-Down When Entering EM2</a>	Yes	C	Future Gecko product
34	IDAC_E201	<a href="#">IDAC CURSTABLE Bit Not Reliable</a>	Yes	C	Future Gecko product
35	I2C_E201	<a href="#">I2C ABORT Command</a>	Yes	C	Future Gecko product
36	LEUART_E201	<a href="#">Restrictions Setting TXDMAWU/RXDMAWU of LEUARTn_CTRL</a>	Yes	C	Future Gecko product
37	RTCC_E201	<a href="#">RTCC Does Not Support Compare/Capture Wrap with Prescaler</a>	Yes	C	Future Gecko product
38	RTCC_E202	<a href="#">RTCC Triggers to LETIMER Not Safe</a>	Yes	C	Future Gecko product
39	TIMER_E201	<a href="#">Timer in Input Capture Mode Can Stop Counting</a>	Yes	C	Future Gecko product
40	FLASH_E201	<a href="#">Potential Program Failure after Power On</a>	Yes	C	Future Gecko product
41	RMU_E201	<a href="#">CTRL Register Reset on All Resets</a>	Yes	C	Future Gecko product

## 2. Detailed Errata Descriptions

### 2.1 ADC\_E202 – Wait After POR or EM4S Wakeup

<b>Description of Errata</b>
Attempting to take an ADC sample too soon after POR or EM4S wakeup can result in an erroneous sample being returned by the ADC.
<b>Affected Conditions / Impacts</b>
ADC can return erroneous sample data.
<b>Workaround</b>
After POR or EM4S wakeup, users must wait 150 $\mu$ s before starting and using the ADC.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

### 2.2 ADC\_E206 – PROGERRIF (Program Error Interrupt Flag) Will Not Clear

<b>Description of Errata</b>
If an invalid selection is made on APORT via POSSEL or NEGSEL by selecting both POSSEL and NEGSEL on the X bus or both on the Y bus, then PROGERRIF will set to 1. If this is followed by a valid internal selection (POSSEL set to AVDD and NEGSEL set to VSS), the PROGERRIF flag will remain 1, even though the selection is valid. This PROGERRIF flag can only be cleared by first making a valid selection of the APORT channels, then moving to an internal selection.
<b>Affected Conditions / Impacts</b>
If firmware attempts to clear the PROGERRIF error condition by selecting a valid non-APORT channel, the PROGERRIF bit will remain set to 1 even after firmware attempts to clear the flag.
<b>Workaround</b>
Firmware can clear the flag by first making a valid selection on POSSEL/NEGSEL to an APORT channel before moving to an internal selection.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

### 2.3 ADC\_E207 – ADC Scan Repeat Mode with APORT

<b>Description of Errata</b>
If Scan repeat mode is enabled, then the ADC sets the correct APORT settings only on the first scan sequence conversion. APORT settings are cleared for all subsequent scan sequence conversions.
<b>Affected Conditions / Impacts</b>
Scan repeat mode does not work with the APORT.
<b>Workaround</b>
There is no known workaround for this issue.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

## 2.4 ADC\_E208 – ADC Interrupt Flags

<b>Description of Errata</b>
The SCANCMP and SINGLECMP interrupt flags in ADCn_IF are not clearable in certain scenarios. These interrupts can trigger multiple times on the same event if the event conditions are not cleared before clearing the interrupt flags.
<b>Affected Conditions / Impacts</b>
Multiple SCANCMP or SINGLECMP interrupts can occur from the same source.
<b>Workaround</b>
Once an interrupt is received, either disable the compare logic (clear CMPEN in ADCn_SINGLECTRL or ADCn_SCANCTRL) or clear the FIFO (using ADCn_SINGLEFIFOCLEAR or ADCn_SCANFIFOCLEAR) before clearing the interrupt flags.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

## 2.5 ADC\_E209 – ADC and PRS Triggers

<b>Description of Errata</b>
Scan conversions may become dependent on Single triggers, and vice versa. If both Scan and Single channel mode are set to PRS Timed mode and both Scan and Single triggers are high at the same time before the approximation phase has started, the conversion is halted until both PRS triggers occur.
<b>Affected Conditions / Impacts</b>
A Scan conversion can end up waiting for a Single PRS trigger to go low before it starts the approximation phase, even if the Scan PRS trigger has already gone low, and vice versa.
<b>Workaround</b>
Do not set both ADC Single and Scan to use PRS Timed mode at the same time. Alternatively, if they are both set to use PRS Timed mode simultaneously, ensure that both PRS timed pulses are never high at the same time.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

## 2.6 ADC\_E210 – ADC with PRS and Software Triggers

<b>Description of Errata</b>
<p>Software triggered conversions are affected if the ADC is set to use PRS Timed mode, even when PRSEN is 0. If PRS Timed mode is selected using PRSMODE in ADCn_SCANCTRLX, regardless of what is set in PRSEN:</p> <ol style="list-style-type: none"> <li>1. All channels in the scan sequence (except the first one) experience an additional 2 raw ADC_CLK cycle latency in the conversion. The same 2 cycle latency will be experienced in all subsequent conversions in repeat mode and conversions done due to oversampling in both single and scan mode.</li> <li>2. If the software triggers a conversion and a PRS pulse comes in before the conversion has passed the acquisition phase, the software-triggered conversion will stall and wait for the PRS pulse to go low before starting the approximation phase.</li> </ol>
<b>Affected Conditions / Impacts</b>
<p>When using the PRS Timed mode with ADC scan, the overall scan conversion time will be longer than expected by:</p> <p>Extra ADC_CLK Cycles = <math>2 \times (\text{number of channels scanned} - 1)</math></p> <p>In addition, 1 MSPS sampling will not be reachable with a software trigger, and software triggers may experience a dependency on the PRS triggers.</p>
<b>Workaround</b>
<p>There is currently no workaround for extra clocks generated by PRS Timed mode. When doing software triggered conversions, do not select PRS Timed mode in PRSMODE.</p>
<b>Resolution</b>
<p>This issue will be resolved in a future Gecko product.</p>

## 2.7 ADC\_E211 – ADC Single Repeat Mode and Tailgating

<b>Description of Errata</b>
<p>If the ADC Single repetitive mode is enabled using REP in ADCn_SINGLECTRL and tailgating is enabled by setting TAILGATE in ADCn_CTRL, then the ADC waits for first Scan conversion. Once that completes, a Single conversion starts, but it is stopped by the ADC before it is complete.</p>
<b>Affected Conditions / Impacts</b>
<p>Single repeat mode does not work with tailgating enabled.</p>
<b>Workaround</b>
<p>There is currently no workaround for this issue.</p>
<b>Resolution</b>
<p>This issue will be resolved in a future Gecko product.</p>

## 2.8 ADC\_E212 – ADC with PRS in ASYNC Mode

<b>Description of Errata</b>
<p>The ADC is currently documented as an asynchronous PRS producer. However, when the ADC is setup in ASYNC mode (ADCCLKMODE in ADCn_CTRL is set to ASYNC), the PRS outputs are no longer synchronous to the HPPERCLK.</p>
<b>Affected Conditions / Impacts</b>
<p>The ADC PRS outputs will not be properly synchronized when the ADC is in ASYNC mode.</p>
<b>Workaround</b>
<p>Use the ADC PRS outputs only when the ADC is setup to use SYNC mode (ADCCLKMODE in ADCn_CTRL is set to SYNC).</p>
<b>Resolution</b>
<p>This issue will be resolved in a future Gecko product.</p>

**2.9 ADC\_E213 – ADC KEEPINSLOWACC Mode**

<b>Description of Errata</b>
When WARMUP-MODE in ADCn_CTRL is set to KEEPINSLOWACC, the ADC does not track the input voltage. Also, the ADC keeps the input muxes closed even during channel switching, making it unsafe to operate the ADC in KEEPINSLOWACC mode.
<b>Affected Conditions / Impacts</b>
KEEPINSLOWACC warmup mode does not function properly.
<b>Workaround</b>
There is currently no workaround for this issue.
<b>Resolution</b>
There is currently no resolution for this issue.

**2.10 ADC\_E214 – Using ADC CHCONMODE with PRS**

<b>Description of Errata</b>
When CHCONMODE in ADCn_CTRL is set MAXRESP, the ADC does not work with PRS Timed mode.
<b>Affected Conditions / Impacts</b>
If the PRS pulse is longer than the ADC acquisition time, the input mux select lines are switched during the acquisition phase, causing the results to no longer be usable.
<b>Workaround</b>
PRS Timed mode should not be used with CHCONMODE in ADCn_CTRL set to MAXRESP.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.11 ADC\_E215 – ADC CHCONMODE Set to MAXRESP Causes Extra Latency**

<b>Description of Errata</b>
Setting CHCONMODE in ADCn_CTRL to MAXRESP introduces 7 extra raw ADC_CLK cycles of latency between scan conversions in a sequence.
<b>Affected Conditions / Impacts</b>
The 7 raw ADC_CLK cycles of extra latency impacts the time the sample is taken.
<b>Workaround</b>
Use CHCONMODE set to MAXSETTLE in order to avoid the extra latency.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.12 ADC\_E216 – ADC Conversion Start Delay**

<b>Description of Errata</b>
If CONVSTARTDELAYEN in both SINGLECTRLX and SCANCTRLX registers are set to 1, the ADC will look at CONVSTARTDELAY value set in SINGLECTRLX register regardless of the conversion type (SCAN or SINGLE). If a SCAN conversion is triggered in this scenario, the conversion will be delayed for the value specified in SINGLECTRLX. In all other cases, the ADC behaves as expected.
<b>Affected Conditions / Impacts</b>
Enabling both SINGLE and SCAN conversion start delay can result in unexpected behavior if the delay selection in the SINGLE and SCAN registers is different.
<b>Workaround</b>
If different CONVSTARTDELAY values are desired for SCAN and SINGLE, do not keep both SINGLE CONVSTARTDELAY and SCAN CONVSTARTDELAY enabled at the same time.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.13 ADC\_E217 – Multiple CLK Mode Switches**

<b>Description of Errata</b>
This issue can be encountered if the ADC clock (CLK) mode switches between asynchronous (ASYNC) and synchronous (SYNC) while data is being read. Specifically, this issue can occur if ADC operates in ASYNC mode with converted data being read, then some conversions are done in SYNC mode before being switched back to ASYNC mode again. FIFOCOUNT may show the wrong value when read in ASYNC mode after the last clock mode switch. Note that the recommended procedure for switching CLK modes should always be followed.
<b>Affected Conditions / Impacts</b>
An unexpected value may be read from FIFOCOUNT registers.
<b>Workaround</b>
When switching from SYNC to ASYNC mode more than once, clear the FIFOs using FIFOCLEAR before and after the CLK mode switch.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.14 ADC\_E218 – SINGLEACT and SCANACT Status Flags Delayed**

<b>Description of Errata</b>
Once the SINGELSTART/SCANSTART commands are issued, it takes a few cycles before the ADC SINGLEACT/SCANACT status flags are set.
<b>Affected Conditions / Impacts</b>
The status flags cannot be checked right after the conversion start commands are issued.
<b>Workaround</b>
Firmware that wants to check when a conversion has started after sending a software trigger will need to wait until the corresponding status flag (SINGELACT/SCANACT) goes high before proceeding.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.



**2.15 ADC\_E219 – STOP Command Causing FIFO Corruption**

<b>Description of Errata</b>
If a single or scan conversion is running and a software STOP command is issued, the conversion should stop immediately and the result should be discarded (no FIFO updates should happen). Currently in the ADC, if a single (scan) conversion is stopped by a software STOP command and there is a scan (single) conversion pending, then the conversion will incorrectly continue and the result will be used to update the FIFO.
<b>Affected Conditions / Impacts</b>
Issuing the STOP command can have two different effects.  If the command is sent during a conversion, the effect will be immediate if no other conversion is pending. The immediate effect means stopping the on-going conversion and discarding the current sample.  If the command is sent during a conversion, the on-going conversion will finish, and the current sample will be saved into the corresponding FIFO. This means that the single conversion will fully finish (regardless of the ADC mode, e.g. if in the oversampling mode, the full oversampling will be executed, or if in the repetition mode, the current conversion will finish and then the repetition mode for single will be disabled) and that the scan conversion will fully finish conversion of the current channel, but it will not finish the whole scan sequence (regardless of the ADC mode). In the last case, the scan FIFO will be updated with the data from channels converted so far.
<b>Workaround</b>
If using the STOP command, the effect will be immediate if no scan triggers were pending during the single conversion and vice versa.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.16 ADC\_E220 – AUXHFRCO in ASYNC mode with ASYNC CLK in ASNEEDED mode**

<b>Description of Errata</b>
ADC sampling in the ASYNC ASNEEDED mode when running from the AUXHFRCO can temporarily upset voltage references used in certain analog components. This issue effects the BOD trip point, DCDC voltage accuracy, ACMP reference accuracy, IDAC output current accuracy, and low voltage digital supply voltage accuracy.
<b>Affected Conditions / Impacts</b>
If the ADC is being used in ASYNC mode with AUXHFRCO, ASYNC CLK cannot be used in ASNEEDED mode.
<b>Workaround</b>
If the ADC is being used in ASYNC mode with AUXHFRCO, ASYNC CLK must be set to ALWAYS ON mode.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.17 ADC\_E221 – ADC Temperature Sensor Must be Used in LOWACC Mode**

<b>Description of Errata</b>
The ADC temperature sensor used in HIGHACC mode can temporarily upset voltage references used in certain analog components. This issue affects the BOD trip point, DCDC voltage accuracy, ACMP reference accuracy, IDAC output current accuracy, and low voltage digital supply voltage accuracy.
<b>Affected Conditions / Impacts</b>
If the ADC is being used to take a reading from its internal temperature sensor, ADCn_BIASPROG.GPBIASACC = 0 cannot be used.
<b>Workaround</b>
Use ADCn_BIASPROG.GPBIASACC = 1 when taking temperature measurements.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.18 ADC\_E222 – ADC EM2 Wakeup on a Comparator Match Disables EM2 Entry**

<b>Description of Errata</b>
If the ADC wakes up the system from EM2 on a comparator flag match (CMPEN must be set in SINGLECTRL/SCANCTRL), the wake-up handler will not be able to clear this EM2 wakeup request. This results in the core immediately exiting EM2 on subsequent EM2 entry.
<b>Affected Conditions / Impacts</b>
Systems using the ADC comparator flag match may not be able to enter EM2.
<b>Workaround</b>
To clear the wakeup request, the wakeup handler must do one of the following: <ul style="list-style-type: none"> <li>• Disable CMPEN in the SINGLECTRL/SCANCTRL register.</li> <li>• Reset the ADC FIFO.</li> <li>• Continue performing conversions until an incoming conversion does not pass the CMP threshold set in CMPTHR.</li> </ul> Once one of these conditions has been met, the comparator can be re-enabled (if it was disabled) and the core can enter EM2.
<b>Resolution</b>
There is currently no resolution for this issue.

## 2.19 ADC\_E223 – Delayed ADC Conversion or Warmup Start

<b>Description of Errata</b>
<p>When a new conversion trigger is received from PRS or a software start, the ADC is expected to either:</p> <ol style="list-style-type: none"> <li>1. Immediately start warmup (if ADCn_CTRL_WARMUPMODE is set to NORMAL, KEEPINSTANDBY, or KEEPINSLOWACC).</li> <li>2. Immediately start the conversion (if in KEEPADCWARM warmup mode).</li> </ol> <p>This expected behavior does not occur if the ADC prescaler (ADCn_CTRL_PRESC) is set to a non-zero value, as the start of the ADC warmup or conversion gets delayed by the number of ADC clock cycles specified by the PRESC field.</p>
<b>Affected Conditions / Impacts</b>
Systems using the ADC clock prescaler will see a delay after a start-of-conversion or start-of-warmup trigger and the actual conversion or warmup sequence.
<b>Workaround</b>
For systems that cannot tolerate a delay between the start-of-conversion and actual conversion or before ADC warmup, set ADCn_CTRL_PRESC to 0 and use the prescalars in the CMU to prescale the incoming ADC_CLK.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

## 2.20 CORE\_E201 – SYSTICK and an External Clock

<b>Description of Errata</b>
The core allows two different clock sources for the SysTick counter. The first one is the core free-running clock, which operates correctly. The second source uses the 32 kHz from the RTCC. This pulse width of this clock is not wide enough, which results in missed SysTick counts.
<b>Affected Conditions / Impacts</b>
Firmware should not use the external clock source for the SysTick counter.
<b>Workaround</b>
Use the core free-running clock for the SysTick, which is the default selection.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

## 2.21 DBG\_E201 – AUXHFRCO Debug Limitations

<b>Description of Errata</b>
The AUXHFRCO is the default debug clock, set by DBG in CMU_DBGCLKSEL. Using AUXHFRCO as the debug clock while entering EM2 has the potential of corrupting the system, causing some registers in the TPIU to not retain their value.
<b>Affected Conditions / Impacts</b>
Firmware should not use the AUXHFRCO as the debug clock while entering EM2.
<b>Workaround</b>
When using AUXHFRCO as the debug clock, it must be stopped before entering the EM2 power mode. Alternatively, select another clock source as the debug clock before entering EM2.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

## 2.22 DBG\_E202 – Debug Access to ADC and LEUART not Functioning as Intended

<b>Description of Errata</b>
ADC and LEUART registers that have a side-effect during a read access (i.e., LEUART_RXDATA or other registers that pop data read) continue to execute triggered actions when an attached debugger is performing read accesses. The intended behavior is to halt execution of pop actions when a debugger is attached.
<b>Affected Conditions / Impacts</b>
Some ADC and LEAURT registers will pop data from their respective buffers on read accesses from the debugger.
<b>Workaround</b>
The user needs to be aware that while debugging, reads via the debugger have the same affect as reads by the CPU during normal mode for these registers. To avoid the debugger triggering a data pop from the buffer, the user should avoid setting a memory window over the actionable register(s), as the reads to fetch the data for the debugger memory view would trigger the data pop from the buffer.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

## 2.23 DCDC\_E202 – Regulated DCDC Output Can Dip on EM2 Entry

<b>Description of Errata</b>
The regulated output on DVDD, when using the DCDC, can dip up to 4% during EM2 entry.
<b>Affected Conditions / Impacts</b>
External components operating from DVDD, when regulated by the DCDC, may suffer a depressed supply by up to 4%, which can last approximately 1 ms. Operation of the device is not affected when this occurs.
<b>Workaround</b>
There is currently no workaround for this issue.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

## 2.24 DCDC\_E203 – Regulated DCDC Output Can Dip on EM2 Entry if not in LN Mode

<b>Description of Errata</b>
The regulated output on DVDD, when using the DCDC, can dip up to approximately 9% during EM2 entry if the DCDC has not completed a transition into LN mode. Note that if a switch to LN mode completes prior to entry to EM2, the DCDC can exhibit the behavior described in <a href="#">DCDC_E202</a> .
<b>Affected Conditions / Impacts</b>
External components operating from DVDD, when regulated by the DCDC, may suffer a depressed supply by up to approximately 9%, which can last approximately 1 ms. A BOD reset of the device is possible, but unlikely.
<b>Workaround</b>
Firmware should wait to see LNRUNNING set after initiating a transition of the DCDC into LN mode, before attempting to enter EM2. This workaround is included in v5.0.0 or later of the Gecko SDK.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.25 EFR\_E201 – Bit Access Not Supported for Low Energy Peripherals**

<b>Description of Errata</b>
Bit set and clear operations do not work properly for Low Energy Peripherals including WDOG, PCNT0, LEUART0, LETIMER0, and RTCC.
<b>Affected Conditions / Impacts</b>
To implement bit set or bit clear operations with Low Energy Peripherals, firmware must execute a read-modify-write operation address on the peripheral's registers.
<b>Workaround</b>
To implement bit set or bit clear operations with Low Energy Peripherals (WDOG, PCNT0, LEUART0, LETIMER0, and RTCC), firmware must execute a read-modify-write operation address on the peripheral's registers.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.26 EFR\_E202 – Read-Clear Access for LETIMER0 and RTCC Interrupts**

<b>Description of Errata</b>
The automatic read-clear mechanism for the LETIMER0 and RTCC modules does not actually clear the module interrupts.
<b>Affected Conditions / Impacts</b>
Firmware must be written to manually clear the interrupts for the LETIMER0 and RTCC modules.
<b>Workaround</b>
Firmware must read the LETIMER0 and RTCC interrupts using the module IFS register and clear the interrupts manually by writing to the module IFC register.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.27 EMU\_E201 – High Temperature Operation**

<b>Description of Errata</b>
The performance of analog peripherals at high temperatures (above 50 °C) may change over time. Firmware should periodically adjust the calibration of the analog peripherals to compensate for this behavior.
This issue affects the BOD trip point, dc-dc output voltage accuracy, ACMP reference accuracy, and IDAC output current accuracy in EM2 through EM4H power modes. This does not affect operation of these peripherals in the EM0, EM1, or EM4S power modes.
<b>Affected Conditions / Impacts</b>
The performance of analog peripherals at high temperatures may change over time.
<b>Workaround</b>
The TEMPDRV module in emdrv addresses this issue and should be included in application firmware. This module is automatically included for systems using Silicon Labs software stacks. For systems not using a Silicon Labs stack (i.e., writing code from scratch or using software examples as a starting point), firmware should include the TEMPDRV module and call the <code>TEMPDRV_Init()</code> function to improve high temperature operation (above 50 °C). The module documentation can be found in Simplicity Studio and contains more information about the firmware solution.
See <i>AN1027: EFR32xG1 and EFM32PG1/JG1 High-Temperature Operation</i> for more information.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.28 EMU\_E204 – Restrictions Writing TEMPHIGH and TEMPLOW**

<b>Description of Errata</b>
Writing TEMPHIGH and TEMPLOW in EMU_TEMPLIMITS at certain times can cause erroneous interrupts to occur.
<b>Affected Conditions / Impacts</b>
Writing to TEMPHIGH or TEMPLOW in EMU_TEMPLIMITS at any time may cause the TEMPHIGH and TEMPLOW interrupt flags in EMU_IF to trigger incorrectly.
<b>Workaround</b>
Firmware should only write TEMPHIGH and TEMPLOW within 250 ms of receiving a TEMPLOW, TEMPHIGH, or TEMP interrupt.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.29 EMU\_E205 – Restrictions Reading TEMP**

<b>Description of Errata</b>
Reads of TEMP in EMU_TEMP may not always return the correct value.
<b>Affected Conditions / Impacts</b>
Reading TEMP in EMU_TEMP at any time may read an incorrect value.
<b>Workaround</b>
Firmware should restrict its reading of TEMP to the following scenarios: <ol style="list-style-type: none"> <li>1. Read the TEMP field multiple times until the same value is returned in two consecutive reads.</li> <li>2. Read TEMP within 250 ms of receiving a TEMPLOW, TEMPHIGH, or TEMP interrupt.</li> </ol>
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.30 EMU\_E207 – GPIO State can be Lost During EM4 Recovery**

<b>Description of Errata</b>
Firmware can configure the I/O state to be retained when exiting EM4 by setting EM4IORETMODE in EMU_EM4CTRL. The desired behavior is that firmware can restore the state of the I/Os in EM0 after exit from EM4 via reset while the I/O state is maintained. It is possible for a GPIO saving a non-5 V tolerant (non-OVT) configuration pull-down configuration to lose the pull-down state if 5 V (OVT) tolerance is disabled using GPIO_Px_OVTDIS before restoring the pull-down configuration.
<b>Affected Conditions / Impacts</b>
Restoring the GPIO after an EM4 wakeup improperly can result in the I/O pull-down configuration being lost.
<b>Workaround</b>
The loss of the pull-down state can be avoided by re-enabling the pull-down before disabling the Over Voltage Tolerance for a GPIO using GPIO_Px_OVTDIS.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.31 EMU\_E208 – Occasional Full Reset After Exiting EM4H**

<b>Description of Errata</b>
Exiting EM4H may occasionally cause a full reset causing loss of RTCC counters and result in longer wakeup times on the order of power-on wakeup times.
<b>Affected Conditions / Impacts</b>
When waking up from EM4H, the system does not wait long enough for the BODs to settle before enabling it as a reset source. Even if the power is stable on DECOUPLE, AVDD, or DVDD, the part may see a BOD reset. The reset is reflected in the RESETCAUSE register.
<b>Workaround</b>
The work around is to disable the BOD prior to EM4H entry by doing the following sequence:
<pre>// Unlock access to emu test registers EMU-&gt;TESTLOCK = EMU_TESTLOCK_LOCKKEY_UNLOCK;  // Mask the BOD outputs to avoid resets EMU-&gt;TESTCTRL  = EMU_TESTCTRL_BOD_MASK;</pre>
The BODs will automatically be enabled after EM4H wakeup, but disabling the BOD will also result in disabling the EM4BOD protection. POR reset will still be valid. This work around is not needed for EM4S.
<b>Note:</b> Using this workaround will change the value of the RSTCAUSE register from 0x00010000 (EM4RST) to 0x0000001C (BOD reset) when waking up from EM4H.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.32 EMU\_E209 – Potential EM2 Lock-up when using IDAC or the Debugger with the LDMA**

<b>Description of Errata</b>
The device can lock up if firmware updates the IDAC output just before entering EM2 while the LDMA module is enabled. Similarly, the device can lock up if the Debugger is connected and the firmware enters EM2 while the LDMA module is enabled.
<b>Affected Conditions / Impacts</b>
Systems using the LDMA and IDAC or LDMA and Debugger may no longer function properly after attempting to enter EM2.
<b>Workaround</b>
Two workarounds exist:
<ol style="list-style-type: none"> <li>1. If LDMA functionality in EM2 is not needed, firmware can disable the DMA via the CMU-&gt;HFBUSCLKEN* LDMA bit before entering EM2.</li> <li>2. If LDMA functionality in EM2 is needed, wait for the IDAC output to settle before entry into EM2 or disconnect the debugger before entry into EM2.</li> </ol>
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.33 EMU\_E210 – Potential Power-Down When Entering EM2**

<b>Description of Errata</b>
On the rare occasion when the firmware starts a transition to EM2 while the EMU is updating its Temperature Sensor measurement, and then within a 300 ns window of entering EM2 the system is woken up to EM0 or EM1, the device's internal power system can be erroneously disabled, powering down the device. When this occurs, the device will reset and will set the DECBOD flag in the RMU_RSTCAUSE register.
<b>Affected Conditions / Impacts</b>
Systems that do not use the emdrv TEMPDRV module may experience a power down on these very rare EM2 timing transitions.
<b>Workaround</b>
The TEMPDRV module in emdrv (SDK version v5.0.0 or later) addresses this issue and should be included in application firmware. This module is automatically included for systems using Silicon Labs software stacks. For systems not using a Silicon Labs stack (i.e., writing code from scratch or using software examples as a starting point), firmware should include the TEMPDRV module and call the <code>TEMPDRV_Init()</code> function to prevent this issue from occurring. The module documentation can be found in Simplicity Studio and contains more information about the firmware solution.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.34 IDAC\_E201 – IDAC CURSTABLE Bit Not Reliable**

<b>Description of Errata</b>
The IDAC CURSTABLE flag in IDAC_STATUS may erroneously report that the current output is stable.
<b>Affected Conditions / Impacts</b>
Systems using the IDAC should not rely on the CURSTABLE to determine if the output is stable.
<b>Workaround</b>
The CURSTABLE bit must not be used. Firmware must wait the minimum required IDAC settling time listed in the data sheet.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.35 I2C\_E201 – I2C ABORT Command**

<b>Description of Errata</b>
For on-going transactions, the ABORT command in I2Cn_CMD may cause the I2C module to lock up indefinitely if it is issued in the middle of an I2C transaction.
<b>Affected Conditions / Impacts</b>
During on-going transactions, the ABORT command can cause the I2C receive module FSM to hang, locking up the I2C transaction indefinitely.
<b>Workaround</b>
The ABORT command should only be used after the I2C module is enabled in order to instruct the I2C module that the bus is IDLE. To use the ABORT command during a transaction, the I2C module should be disabled by clearing EN in I2Cn_CTRL.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.



**2.36 LEUART\_E201 – Restrictions Setting TXDMAWU/RXDMAWU of LEUARTn\_CTRL**

<b>Description of Errata</b>
Changing the value of TXDMAWU while TXEN = 1 or RXDMAWU while RXEN = 1 in LEUARTn_CMD could potentially cause unpredictable behavior.
<b>Affected Conditions / Impacts</b>
If the TXDMAWU field is updated while TXEN = 1 or the RXDMAWU field is updated while RXEN = 1, a spurious DMA wake-up event could be created.
<b>Workaround</b>
Firmware should first disable the receive or transmit path using RXEN or TXEN in LEAURTn_CMD before changing RXDMAWU or TXDMAWU.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.37 RTCC\_E201 – RTCC Does Not Support Compare/Capture Wrap with Prescaler**

<b>Description of Errata</b>
When the RTCC is configured with a prescaler, the CCV1 top value enable feature enabled by setting CCV1TOP in RTCC_CTRL fails to wrap the counter when RTCC_CNT is equal to RTCC_CC1_CCV, as intended.
<b>Affected Conditions / Impacts</b>
Using CCV1TOP with a prescaled RTCC may result in the RTCC not wrapping at the desired time.
<b>Workaround</b>
Do not use a prescaler with the RTCC when using the CCV1TOP feature.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

**2.38 RTCC\_E202 – RTCC Triggers to LETIMER Not Safe**

<b>Description of Errata</b>
The LETIMER inputs from the RTCC are connected to the LFECLK domain, while the LETIMER itself is clocked from the LFACLK domain. This results in synchronization issues between the RTCC inputs to the LETIMER and the LETIMER.
<b>Affected Conditions / Impacts</b>
RTCC triggers to LETIMER are not safe and can result in undefined behavior.
<b>Workaround</b>
Do not use RTCC triggers for LETIMER. PRS channels can be used as an alternative.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

### 2.39 TIMER\_E201 – Timer in Input Capture Mode Can Stop Counting

<b>Description of Errata</b>
When RISEA/FALLA is configured to RELOADSTART and then changed to any other mode at the same time as when a pulse from CC0 or PRS input occurs, the counter could stop running.
<b>Affected Conditions / Impacts</b>
The timer may not count properly in all situations.
<b>Workaround</b>
To prevent input pulses while changing RISEA/FALLA: <ol style="list-style-type: none"> <li>1. If using PRS, before changing RISEA/FALLA from RELOADSTART to any other value, change the input to some other PRS input by using PRSSEL in TIMERN_CC0_CTRL. After clearing RISEA/FALLA, set PRSSEL back to the original value</li> <li>2. If using CC0 in, set GPIO mode to DISABLE for that pin before changing RISEA/FALLA. Then, set it back to INPUT mode after changing RISEA/FALLA.</li> </ol>
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

### 2.40 FLASH\_E201 – Potential Program Failure after Power On

<b>Description of Errata</b>
There is very small probability that, with some devices, the first program of flash after a power on cycle or wake-up from EM2, EM3, EM4H, or EM4S may not take effect unless the flash has first been programmed or erased. This issue affects all devices, though the probability of the failure occurring on each device may differ.
<b>Affected Conditions / Impacts</b>
After a power-on, the first program of flash initiated by firmware may not take effect.
<b>Workaround</b>
To ensure the flash is programmed correctly, firmware should program the flash, verify the flash contents, and reprogram the flash, if necessary. This workaround is included in v4.4.0 or later of the Gecko SDK. Note that typical word (32-bit) programming time is 26 $\mu$ s, while it only takes several tens of ns to read and verify, so the overhead is minimal.  An alternative workaround is to erase the flash page before programming after a power on cycle or wake-up from EM2, EM3, EM4S, or EM4H.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

### 2.41 RMU\_E201 – CTRL Register Reset on All Resets

<b>Description of Errata</b>
The RMU->CTRL register is reset to default state on every system reset, not only POR and hard pin reset as stated in the reference manual.
<b>Affected Conditions / Impacts</b>
The RMU->CTRL register is reset to default state on every system reset, not only POR and hard pin reset as stated in the reference manual.
<b>Workaround</b>
Firmware should always update RMU->CTRL after a reset. Note that the LOCKUP reset is disabled by default.
<b>Resolution</b>
This issue will be resolved in a future Gecko product.

### 3. Revision History

#### 3.1 Revision 1.5

November 11th, 2016

Updated the resolution for all previous errata other than ADC\_E213 as fixed in a future Gecko product.

Added [ADC\\_E220](#), [ADC\\_E221](#), [ADC\\_E222](#), [ADC\\_E223](#), [DCDC\\_E202](#), [DCDC\\_E203](#), [EMU\\_E209](#), and [EMU\\_E210](#).

Added a reference to AN1027 to [EMU\\_E201](#).

Added a note to the workaround for [EMU\\_E208](#).

#### 3.2 Revision 1.4

April 25th, 2016

Updated the latest revision to revision C.

Added [TIMER\\_E201](#), [ADC\\_E216](#), [ADC\\_E217](#), [ADC\\_E218](#), [ADC\\_E219](#), [EMU\\_E208](#), [FLASH\\_E201](#), [RTCC\\_E202](#), and [RMU\\_E201](#).

Moved [CUR\\_E201](#), [CUR\\_E202](#), and [GPIO\\_E201](#) to the errata history. Also added [DCDC\\_E201](#) to the errata history.

#### 3.3 Revision 1.3

February 5th, 2016

Added [GPIO\\_E201](#).


#### 3.4 Revision 1.2

December 7th, 2015

Initial release.

Silicon Labs

# Simplicity Studio™4

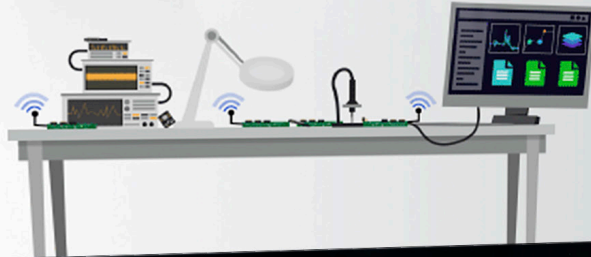

## Simplicity Studio

One-click access to MCU and wireless tools, documentation, software, source code libraries & more. Available for Windows, Mac and Linux!



IoT Portfolio  
[www.silabs.com/IoT](http://www.silabs.com/IoT)



SW/HW  
[www.silabs.com/simplicity](http://www.silabs.com/simplicity)



Quality  
[www.silabs.com/quality](http://www.silabs.com/quality)



Support and Community  
[community.silabs.com](http://community.silabs.com)

### Disclaimer

Silicon Labs intends to provide customers with the latest, accurate, and in-depth documentation of all peripherals and modules available for system and software implementers using or intending to use the Silicon Labs products. Characterization data, available modules and peripherals, memory sizes and memory addresses refer to each specific device, and "Typical" parameters provided can and do vary in different applications. Application examples described herein are for illustrative purposes only. Silicon Labs reserves the right to make changes without further notice and limitation to product information, specifications, and descriptions herein, and does not give warranties as to the accuracy or completeness of the included information. Silicon Labs shall have no liability for the consequences of use of the information supplied herein. This document does not imply or express copyright licenses granted hereunder to design or fabricate any integrated circuits. The products are not designed or authorized to be used within any Life Support System without the specific written consent of Silicon Labs. A "Life Support System" is any product or system intended to support or sustain life and/or health, which, if it fails, can be reasonably expected to result in significant personal injury or death. Silicon Labs products are not designed or authorized for military applications. Silicon Labs products shall under no circumstances be used in weapons of mass destruction including (but not limited to) nuclear, biological or chemical weapons, or missiles capable of delivering such weapons.

### Trademark Information

Silicon Laboratories Inc.®, Silicon Laboratories®, Silicon Labs®, SiLabs® and the Silicon Labs logo®, Bluegiga®, Bluegiga Logo®, Clockbuilder®, CMEMS®, DSPLL®, EFM®, EFM32®, EFR®, Ember®, Energy Micro, Energy Micro logo and combinations thereof, "the world's most energy friendly microcontrollers", Ember®, EZLink®, EZRadio®, EZRadioPRO®, Gecko®, ISOModem®, Precision32®, ProSLIC®, Simplicity Studio®, SiPHY®, Telegesis, the Telegesis Logo®, USBXpress® and others are trademarks or registered trademarks of Silicon Labs. ARM, CORTEX, Cortex-M3 and THUMB are trademarks or registered trademarks of ARM Holdings. Keil is a registered trademark of ARM Limited. All other products or brand names mentioned herein are trademarks of their respective holders.



**SILICON LABS**

Silicon Laboratories Inc.  
400 West Cesar Chavez  
Austin, TX 78701  
USA

<http://www.silabs.com>